

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: CDP-C5F/C5S/C50/C57

No. 40

Subject: Incorrect Disc Count



Date: October 17, 1988

Symptom:
(22)

The disc is inserted in a particular receptacle such as #1, but when the draw is closed it stops at another position (usually the next lower or higher). The Led of the incorrect position lights. The disc counting pulses are incorrectly read by IC701.

Solution: Change the value of the following components:

| Ref. No. | Description | |
|----------|-------------------|-------------------|
| | Former | New |
| C560 | 22uf, 25V | 10uf, 25V |
| R593 | 47k, 1/6 watt, 5% | 33k, 1/6 watt, 5% |

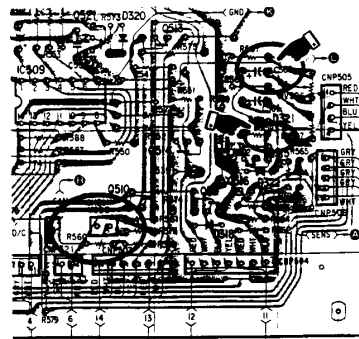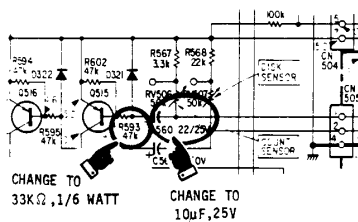

Compact Disc
CSA-13

Reference:

PRINTED IN U.S.A.
CSA-131088-3