

SONY

Dictation Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: BM-246

No. 3

Subject: Record Shut-Off

Date:

Symptom:
(55)

When lesser quality tape or cassette eraser is used, recording may stop due to record inhibit circuit.

Solution: The following modification reduces the sensitivity of the record inhibit circuit.

Add 22k Ohm 1/4W resistor in parallel with R169 and R269.
Add 10uf 16V capacitor in parallel with C162 and C262.

Description	Part Number
22k Ohm 1/4W	1-249-433-11
10uf 16V	1-126-157-11

CSA-15 Court/Conference

Reference:

PRINTED IN U.S.A.
CSA-15491-2