

SONY

Hi-Fi Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: TC-K700ES

No. 7

Subject: Improvement of Wow and Flutter

Date: February 25, 1988

Symptom:
(62)

Wow and flutter is generated just after play is initiated.


Solution:

Add an 820K Ω resistor (P/N 1-215-491-00) in parallel with C715 on the system control board.

Please note affected serial numbers.

Description	Part Number
820K Ω Resistor	1-215-491-00

【System Control Board】

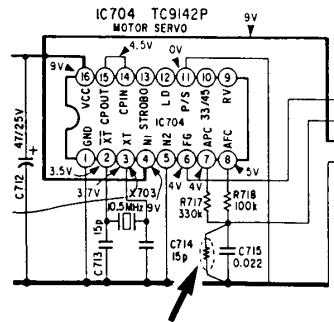

Mount a 820K Ω resistor here

affected Serial Numbers

US Model: up to 800,500

Reference:

PRINTED IN U.S.A.
CSA-13288-5

CSA-13 Tame Deck