

**Model:** KP-53XBR45, KP-61XBR48

**No. 423**

**Subject: D Board Part Number Correction  
Reference No. 188**

**Date:** September 20, 1999

**Symptom:**

**(xxxx)**

The part number listed on page 109, and 128, of the Service Manual for Ref # 188, D Board, is incorrect.

**Solution:**

Please note the correct part number as shown below.

REF	PAGE	DESCRIPTION	PART NUMBER	
			INCORRECT	CORRECT
188	109	D BOARD	A-1346-296-A	A-1346-537-A
	128	D BOARD	A-1346-296-A	A-1346-537-A

To ensure the availability of the "D" Board to our servicers, Please make a concerted effort to return defective boards, immediately to the address below. Thereby allowing them to be refurbished and returned to stock.

Sony Technology Center Pittsburgh  
Attn. (SAYS Program)  
Receiving Door # 22  
1001 Technology Drive  
Mount Pleasant, Pennsylvania 15666-1770

If the "D" Board is not available, please attempt to repair the Board in the field. Repair records indicate the following items should be checked on the "D" Board.

Component	Description	Part Number	Symptom
IC-1601, 1602	Sub-DY Drive	8-749-010-88	No power/Distorted color
IC-1801, 1805	G & R Conv. Corr.	8-759-464-79	Distorted picture
IC-1802	H Wave gen.	8-759-327-51	No convergence
IC-1501	Vert. Output	8-759-192-71	Insufficient /no vertical
R-1519, 1520	Fuse res. 2.2 Ohm	1-249-385-11	Insufficient /no vertical
F1601, 1602	Fuse Glass 3.15/125v	1-532-745-11	No picture
C-1502	IC-1501/ pin 4	1-126-943-11	Insufficient /no vertical

