

CONFIDENTIAL

CSV-1

Sony Service Company National Technical Services A Division of Sony Electronics Inc. Park Ridge, New Jersey 07656

Service Bulletin TV Products

Model: KP-53XBR45, KP-61XBR48 No. 388

Subject: Fuse resistor not listed Date: January 20, 1999

Symptom:

(1311) No picture CRT filament is not lit. Fuse resistor R-866 is open. This resistor is not

listed in the Service Manual parts list or show in the schematic.


Solution:

The E board was changed starting with Suffix –14. When fuse resistor R866 and R865 was added. Please see the schematic and Ref. chart below for the proper Part Number and schematic diagram.

Number and schematic diagram.

This resistor is located between T-803/pin 17 and CN-802/pin 1. R-865 is in series with this fuse resistor.

Ref.	Description	Part Number
R865	1.2 ohm 2 watt resistor	1-216-370-11
R866	3.15a Micro Fuse resistor	1-532-781-11

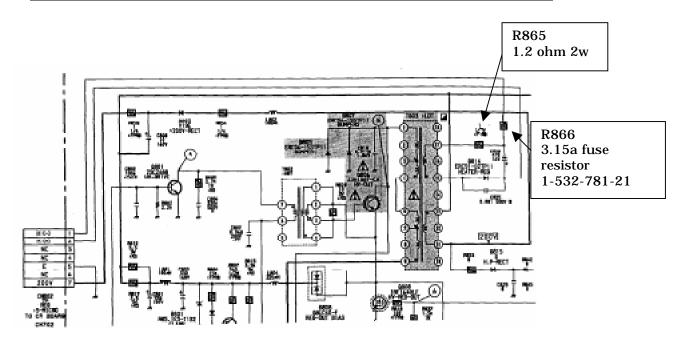

Reference: FPR-T0600 PRINTED IN USA