

SONY

Video Products
Service Bulletin

Sony Service Company - Technical Services
A Division of Sony Corporation of America
Sony Drive, Park Ridge, New Jersey 07656

Model: SLV-353UC/373UC/555UC/575UC/585HF/
686HF/676UC/757UC/P33/R5UC

No. 170

Subject: RVS Cam Gear Stripping - Replacement Kit

Date: September 9, 1991

Symptom:
(63) Stripped RVS Cam Gears. This is a result of using VHS Tapes which are not made to specifications.

Solution: If this problem occurs, please replace the following parts which are contained in the RVS Arm Kit:

DESCRIPTION	PART NUMBER	CONTENTS OF KIT
RVS ARM KIT	A-6759-536-A	1. RVS CAM GEAR, 3-736-143-01
		2. RVS ARM ASSY, X-3729-911-11
		3. STOPPER WASHER (2), 3-669-595-00

VHS
CSV-2