Out of Tun=

OUT OF TUNE

In "Audio Power Meter," October 1979, the resistor connected to pin 5 of IC2B should be R27 and there should be no connection between its other end (point L) and R26. The pc pattern is correct. The meter, M1, should be 0-1 mA as in the Parts List, not 0-1 µA. Also, in the Parts List, s3 should be listed as a spdt not spst switch. Under Calibration, in the text on page 67, at the top of the third column, after applying the 6.0-V signal to R3 and R4, add the instruction to adjust R8 to obtain a null on the meter. Then remove the signal from R3 and R4 and remove power.

In "NASA Motor-Control Circuit Cuts Electric Cost" (October 1979), in Fig. 2, the center tap of 71 should be connected to the bottom of R1, not the top.

POPULAR ELECTRONICS