


REVISIONS				
ZONE	REV.	DESCRIPTION	DATE	APPROVED
	A	CORRECTED TO PCB, RELEASE	11/17/92	
	B	ADDED C226	12/17/92	
	C	CHG'D GYRATOR PARTS TO 1%	12/20/92	
	D	ADDED C227	12/22/92	
	E	ADDED R243, 44, 45 & R246,	12/29/92	
		REMOVED C226, C227, R243, R244, R245, R246		
B7	F	ADDED UCAB II CHANGES	11-4-94	DJT

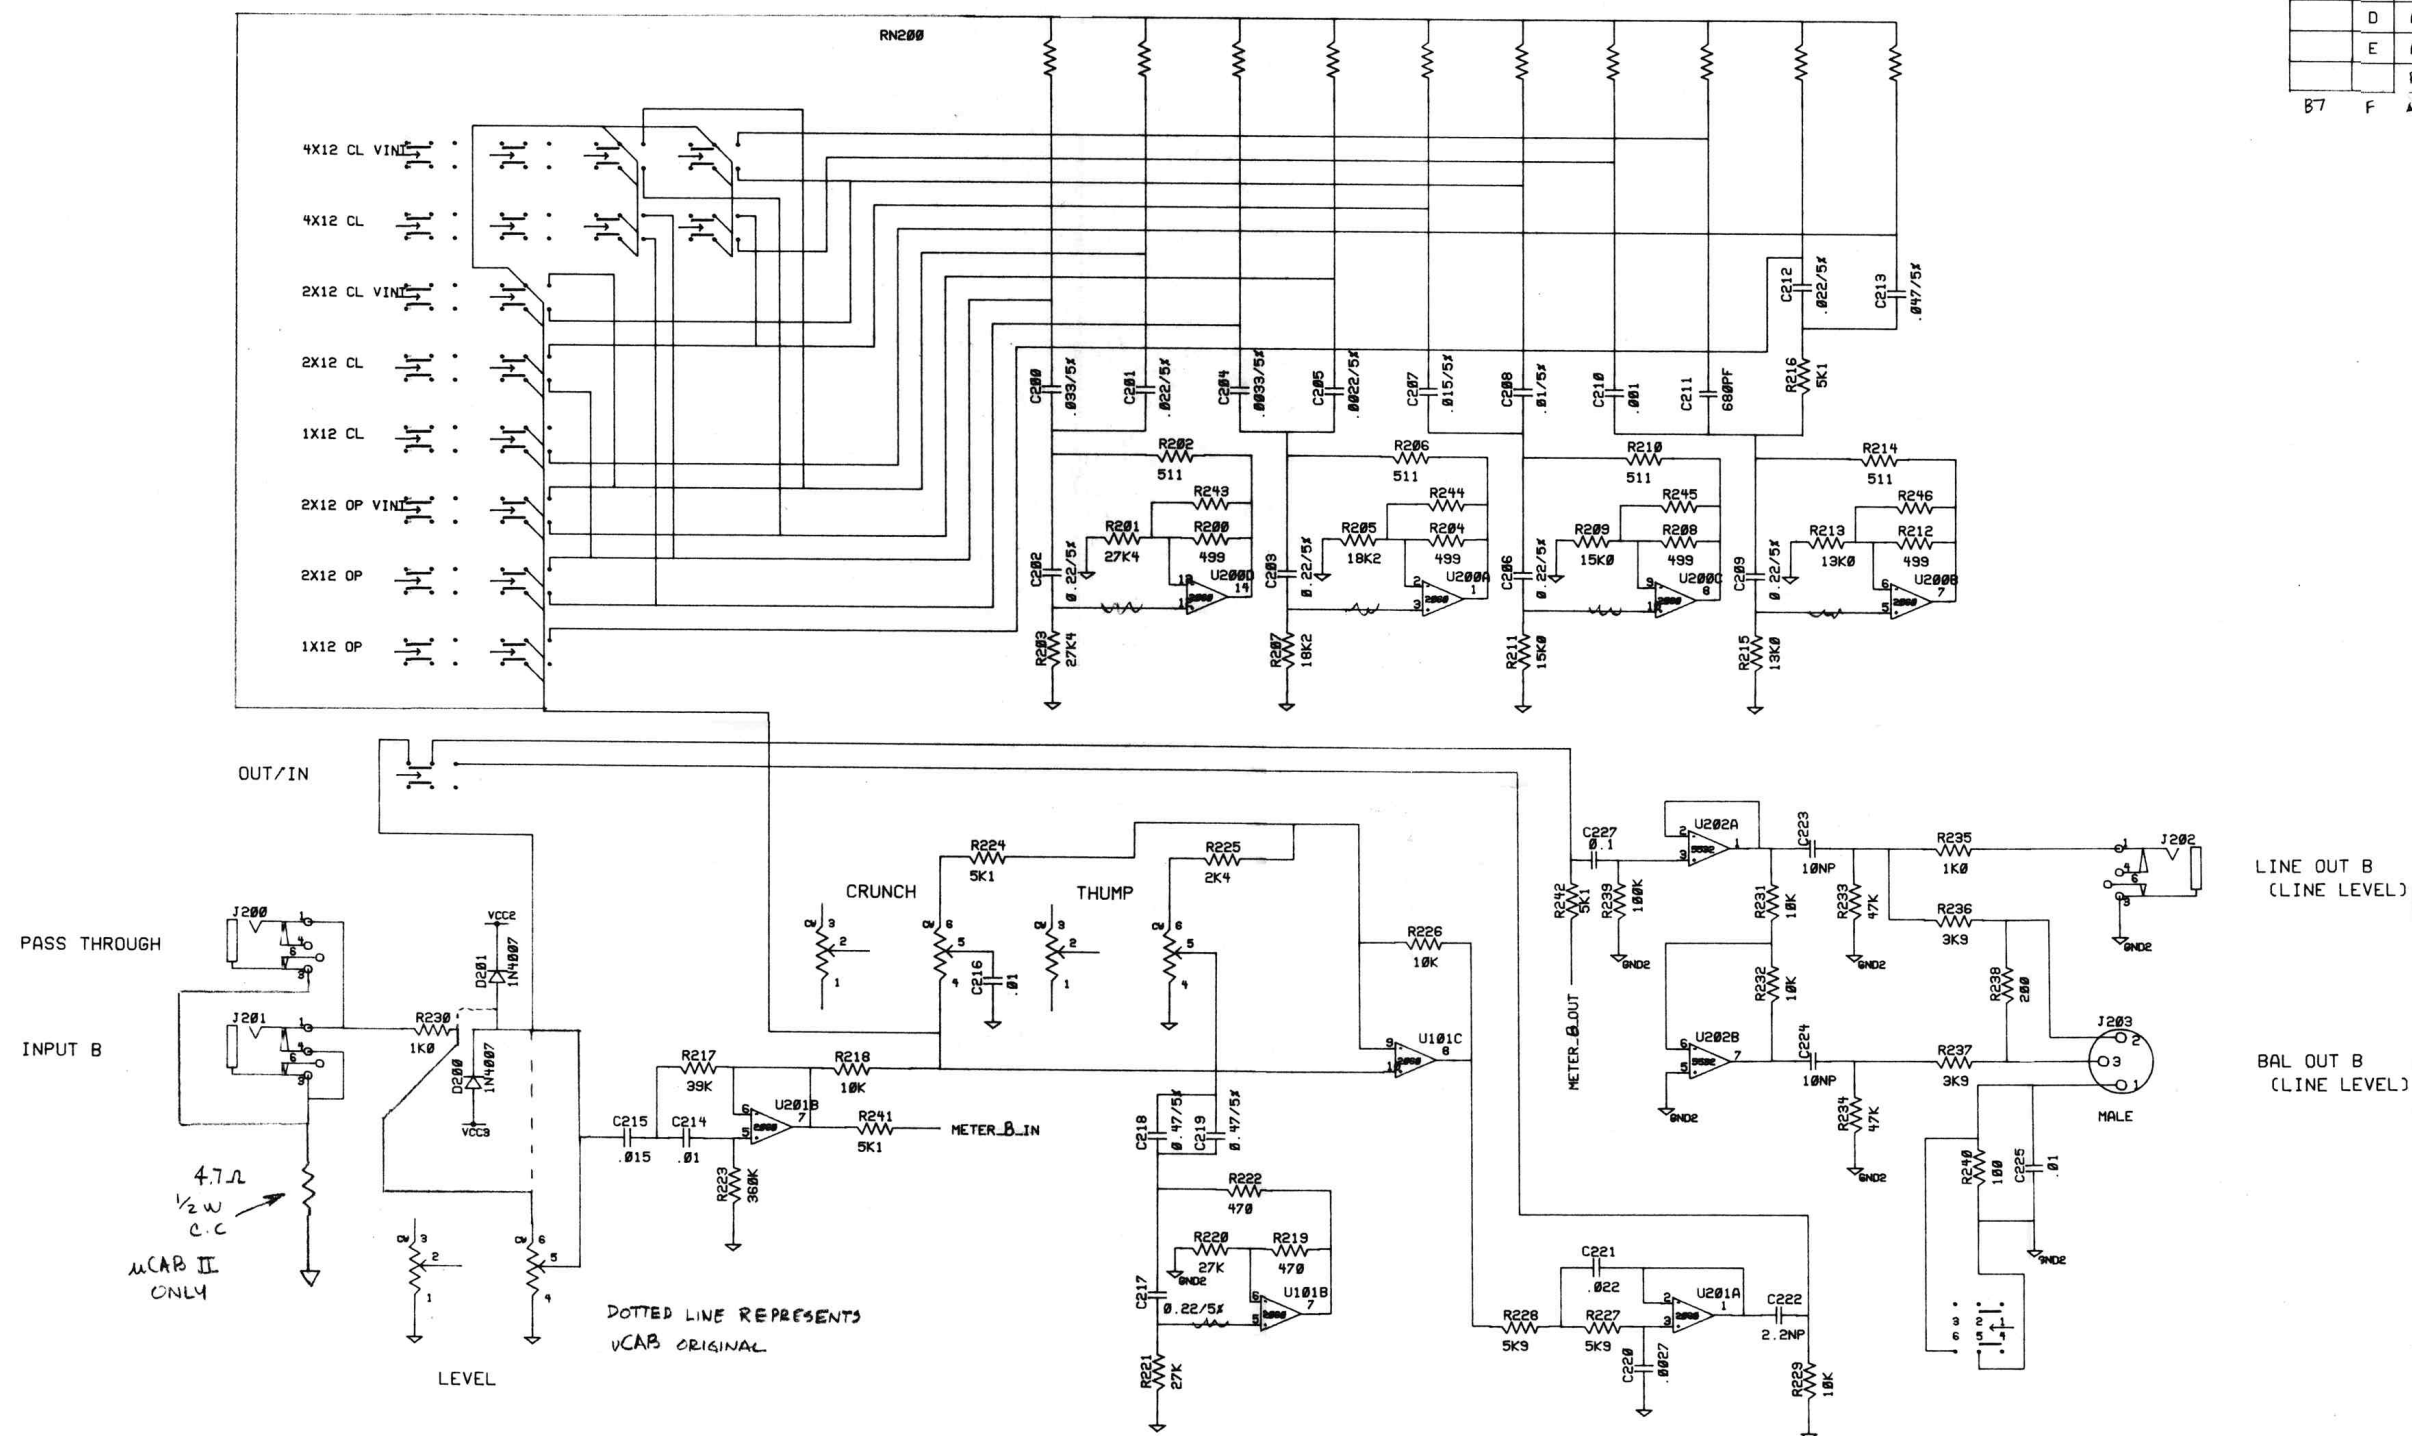

NOTES:

1. R243, R244, R245 & R246 ARE NOT NORMALLY STUFFED: THEY ARE TO BE INSTALLED ONLY WHEN IT IS NECESSARY TO TRIM THE GAIN OF THE ASSOCIATED GYRATOR.
2. PCB 680098 REV F

PROPRIETARY THIS DRAWING DOCUMENT CONTAINS INFORMATION WHICH IS PROPRIETARY TO AND IS THE PROPERTY OF ADA SIGNAL PROCESSORS, INC. AND MAY NOT BE USED, REPRODUCED OR DISCLOSED IN ANY MANNER WITHOUT THE EXPRESSED WRITTEN CONSENT OF ADA SIGNAL PROCESSORS, INC.		ADA SIGNAL PROCESSORS, INC. 420 LESSER STREET OAKLAND, CA 94601	
DATABASE FILE: UCAB.DBF		SCHEMATIC, MICRO-CAB II AUDIO CHANNEL B	
DRAWN: DRW	SIZE: D	DRAWING NUMBER: 808	REV: F
CHECKED BY:	ENGR: RTS	SCALE:	DATE: 30-DEC-94 SHEET 2 OF 3
APPROVED:			